

27/11/2008 2:21:26 PM

## Process Sheet

: CU-DAR001 Dart Helicopters Services      Drawing Name : HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B  
 : 43796A  
 : 10163  
 P.O. Number :  
 This Issue : 27/11/2008      S.O. No. :  
 Prsht Rev. : NC  
 First Issue : / /      Type : SKIDTUBES  
 Previous Run : 43795A  
 Written By :  
 Checked & Approved By : JUD 08.11.27  
 Comment : Est Rev:M 04.12.02      Revised procedural steps      KJ/JLM  
 Part Number : D206642241  
 Drawing Number : D2650 REV F  
 Project Number : N/A  
 Drawing Revision : F  
 Material :  
 Due Date : 20/12/2008      Qty: 1      Um: Each

## Additional Product

Job Number:



Seq. #:      Machine Or Operation:      Description :

1.0      DC      DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile &amp; type labels per PPP D206-642-241      CHG003      N/A

2.0      D2620      Skidtube, 206 Skidtube



Comment: Qty.: 1.0000 Each(s)/Unit      Total : 1.0000 Each(s)

Pick:

Qty Part Number      Description      Batch

1      D2620      Bent Tube 3" OD      B3845

DP 8-12-4

3.0      D32861      Doubler



Comment: Qty.: 2.0000 Each(s)/Unit      Total : 2.0000 Each(s)

Pick:

Qty Part Number      Description      Batch

2      D3286-1      Doubler      43121

SL 8-12-7

4.0      D2647      Cap



Comment: Qty.: 1.0000 Each(s)/Unit      Total : 1.0000 Each(s)

Pick:

Qty Part Number      Description      Batch

1      D2647      Fwd Cap      B35475

BE 8-12-5

5.0      SKIDTUBES 1      SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Deburr Fwd edge of tube

DP 8-12-4

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description:

2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650

*DP 8-12-4*

3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod *m/109560/m 109213* *BE 8-12-5*

4-Grind weld flush to cap on top surface only.

*BE 8-12-5*

5-Cut Aft end as per dwg 2650 from front of tube and Deburr

6-Remove inner indexing ridge on Aft end of skidtube as per Dwg D2650

7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025.

8-Drill pilot holes using Dt 8167.

9-Locate DT8732 from inner Aft saddle hole & 3rd crossbolt hole. Insert D3286-1 doubler using DT8732 & D206-642-241-T1, then locating doubler off of 3/16" holes, cleco DT8732 & doubler leaving DT8732 for added support.

10- Drill D3286-1 doubler rivet holes in tube using # 40 drill, spot drilling doubler at the same time.

11-Working from the center out, drill # 30 holes into D3286-1 doubler. Cleco each hole as it is being drilled. Verify angle of holes to accommodate rivet heads.

12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650

13-Remove D3286-1 doublers, identify orientation, deburr, then attach them to the workorder

14-Remove indexing edge using DT8741 as per Dwg D2650

15-C'sink GHW rivet holes as per Dwg D2650

*518-12-7*

6.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

*S 06/12/08*

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #: Machine Or Operation: Description :

7.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open crossbolt holes to Ø0.3125" as per Dwg D2650

2-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6.

3-Deburr tube and blow out chips from inside the tube

*MB*  
*08-12-11*

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

*AM* *08-12-11*

9.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

*BE* *08-12-11* *(ix)*

10.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open holes to finished size as per Dwg D2650, D2650-3 Drilling Detail (without cutting fluid)

2-C'sink crossbolt spacer holes as per Dwg D2650(without cutting fluid)

3-Deburr and blow out all chips from inside the tube

*MB BE*  
*08-12-11*

11.0

QC6

DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

*08/12/11*

12.0

CR3212404

Cherry Rivet



Comment: Qty.: 52.0000 Each(s)/Unit Total: 52.0000 Each(s)

Pick:

Qty Part Number Description Batch

52 CR3212-4-04 Rivet

*109740* *x12* *110153x* *(42)* *SL 8-12-12*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #: Machine Or Operation: Description :

13.0 D26543 Web



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2654-3 Web 43850

SL 8-12-12

14.0 SKIDTUBES 1 SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required

2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up. Allow 12 Hrs. cure time before cutting

Start Date: 8-12-12 Time: 8:00

Finish Date: 8/12/15 Time: 8:15 AM

Pick:

Qty Part Number Description Batch

A/R Sikaflex-291 109883

Sikaflex expire date: 09-07-11

SL 8-12-12

15.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8 08/12/15 (20)

16.0 D2649 Cross Bolt Spacer



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch

18 D2649 Crossbolt spacer B41910

pm 08-12-15

17.0 D32863 Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3286-3 Spacer B43648

BE 8-12-17

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001: Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

SKIDTUBES 1

SKIDTUBESS RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Insert D2649 crossbolt spacers. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod.

Pick:

Qty Part Number Description Batch

A/R Aluminum Rod m109213 BE 08/12/15

2-Grind welds flush as per Dwg D2650. AWM 8-12-16

3-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required.

A/RSS Rod NONE BE 8-12-17

4-Counterbore 5/16" x 0.750" deep except 7th hole from Aft end as per Dwg D2650. Deburr Pm' 08-12-18

19.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 CCR264SS33 Rivets m110122

Pm' 08-12-18

20.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Cherry Rivet

batch: m110139

Pm' 08-12-18

21.0

D2680041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2680-041 Nut Plate B 34599

Pm' 08-12-18

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #: Machine Or Operation: Description :

22.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Install D2680-041 Nut Plate as per Dwg D2650

pm 08-12-18

23.0 QC9 VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

S 08/12/18 / 08/12/18

24.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/12/18 (X)

25.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Pressure wash as per QSI 005

FL 09/01/08 (1)

26.0 POWDER COATING POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref. 4.3.5.1) as per QSI 005 4.3. Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs.

START TIME:

2:15

OVEN TEMPERATURE:

320°

FINISH TIME:

2:45

FL 09/01/08 (1)

27.0 QC3 INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

09-01-13

(X1)

28.0 D26483 Wearpad



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 D2648-3

Wearpad

13 43802

FL 09-01-13

(X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

29.0	D265613	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-13	Wearshoe	B40897

94

30.0	D265621	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-21	Wearshoe	B43992

94

31.0	D265633	Wearplate
------	---------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D2656-33	Wearshoe	B26756

98

32.0	D34291	Wearpad
------	--------	---------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D3429-1	Wearpad	B42779

\* 98

33.0	ALS41032130	Insert
------	-------------	--------



Comment: Qty.: 44.0000 Each(s)/Unit Total : 44.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
44	ALS4-1032-130	Inserts	M105819

or (see QSI 017)

98

09-01-13

98

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #: Machine Or Operation: Description :

34.0 AN960JD10L Washer



Comment: Qty.: 46.0000 Each(s)/Unit Total: 46.0000 Each(s)

Pick:

Qty Part Number Description Batch  
46 AN960JD10L Washer M105793

*JA*

35.0 MS27039108 Screw



Comment: Qty.: 46.0000 Each(s)/Unit Total: 46.0000 Each(s)

Pick:

Qty Part Number Description Batch  
46 MS27039-1-08 Screw M110450

*JA*

36.0 D26511 Plug



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch  
18 D2651-1 Plugs D42153

*JA*

37.0 D26513 O-Ring



Comment: Qty.: 18.0000 Each(s)/Unit Total: 18.0000 Each(s)

Pick:

Qty Part Number Description Batch  
18 D2651-3 O-Rings B41972

*JA*

38.0 MS27039406 Screw



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
1 MS27039-4-06 Screw M109061

*JA*

39.0 AN960JD416 Washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch  
1 AN960JD416 Washer M108161

*JA*

09-01-13 (X1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries



Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #: Machine Or Operation: Description :

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1]

1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

A/R Sikaflex-291

111109883

Sikaflex expire date:

09/11

2-Install D2651-3 O-Rings on D2651-1 plugs with Petroleum Jelly and install plugs as per Dwg D2650 (D2650-3 detail). Clean excess adhesive.

3-Install MS27039-4-06 Screw as per DEO 9153.

21 09-01-13 (40)

41.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap

1341435

21

09-01-13

42.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install D2646 Aft Cap and seal with Sikaflex. Clean excess adhesive

A/R Sikaflex-291

11109883

Sikaflex expire date:

09/11

2-Wing Walk as per Dwg D2650-3 and QSI 005 4.4

Batch:

m109917

- FZ 09/01/13 (42)

43.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 09/01/13 (43)

44.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/01/13 (44)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

**NOTE:** Date & initial all entries

Date: Thursday, 27/11/2008 2:21:26 PM  
User: Julie Dawson

## Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: HIGH GEAR SKIDTUBE ASSEMBLY 206 A/B

Job Number: 43796A

Part Number: D206642241

Job Number:



Seq. #:

Machine Or Operation:

Description :

45.0

PACKAGING 1

PACKAGING RESOURCE #1



(14)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206664241 IF APPLICABLE

Location:

PPP Rev:

PPP 4379650

9/1/15

50

46.0

QC21

FINAL INSPECTION/W/O RELEASE



09/01/15

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



u 29.06.15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: \_\_\_\_\_ PAR #: \_\_\_\_\_ Fault Category: \_\_\_\_\_ NCR: Yes No DQA: \_\_\_\_\_ Date: \_\_\_\_\_

Resolution: \_\_\_\_\_ Disposition: \_\_\_\_\_ QA: N/C Closed: \_\_\_\_\_ Date: \_\_\_\_\_

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F

F



#### NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1  
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3  
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:  
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 43264

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	RMOVE CBORE, CHG DRILL, ADD CHAMFER	CP	06.03.30
D	REDRAW; INCRP. DE09136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC PORT HADLOCK, WA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 1 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	




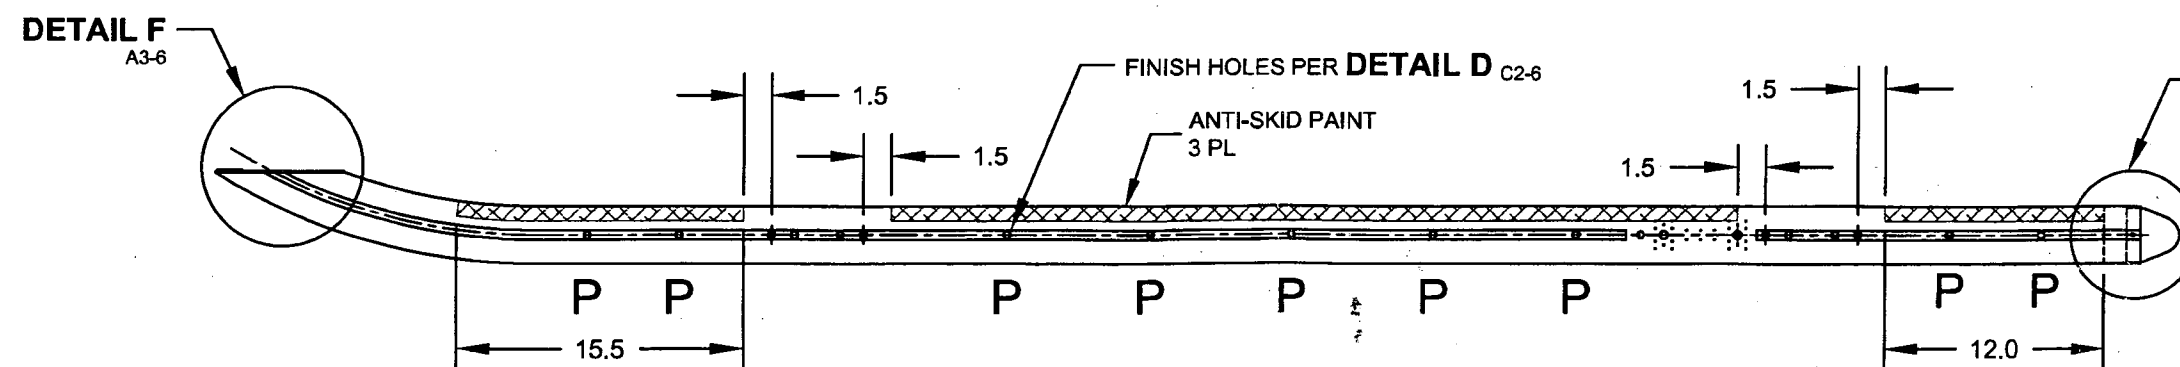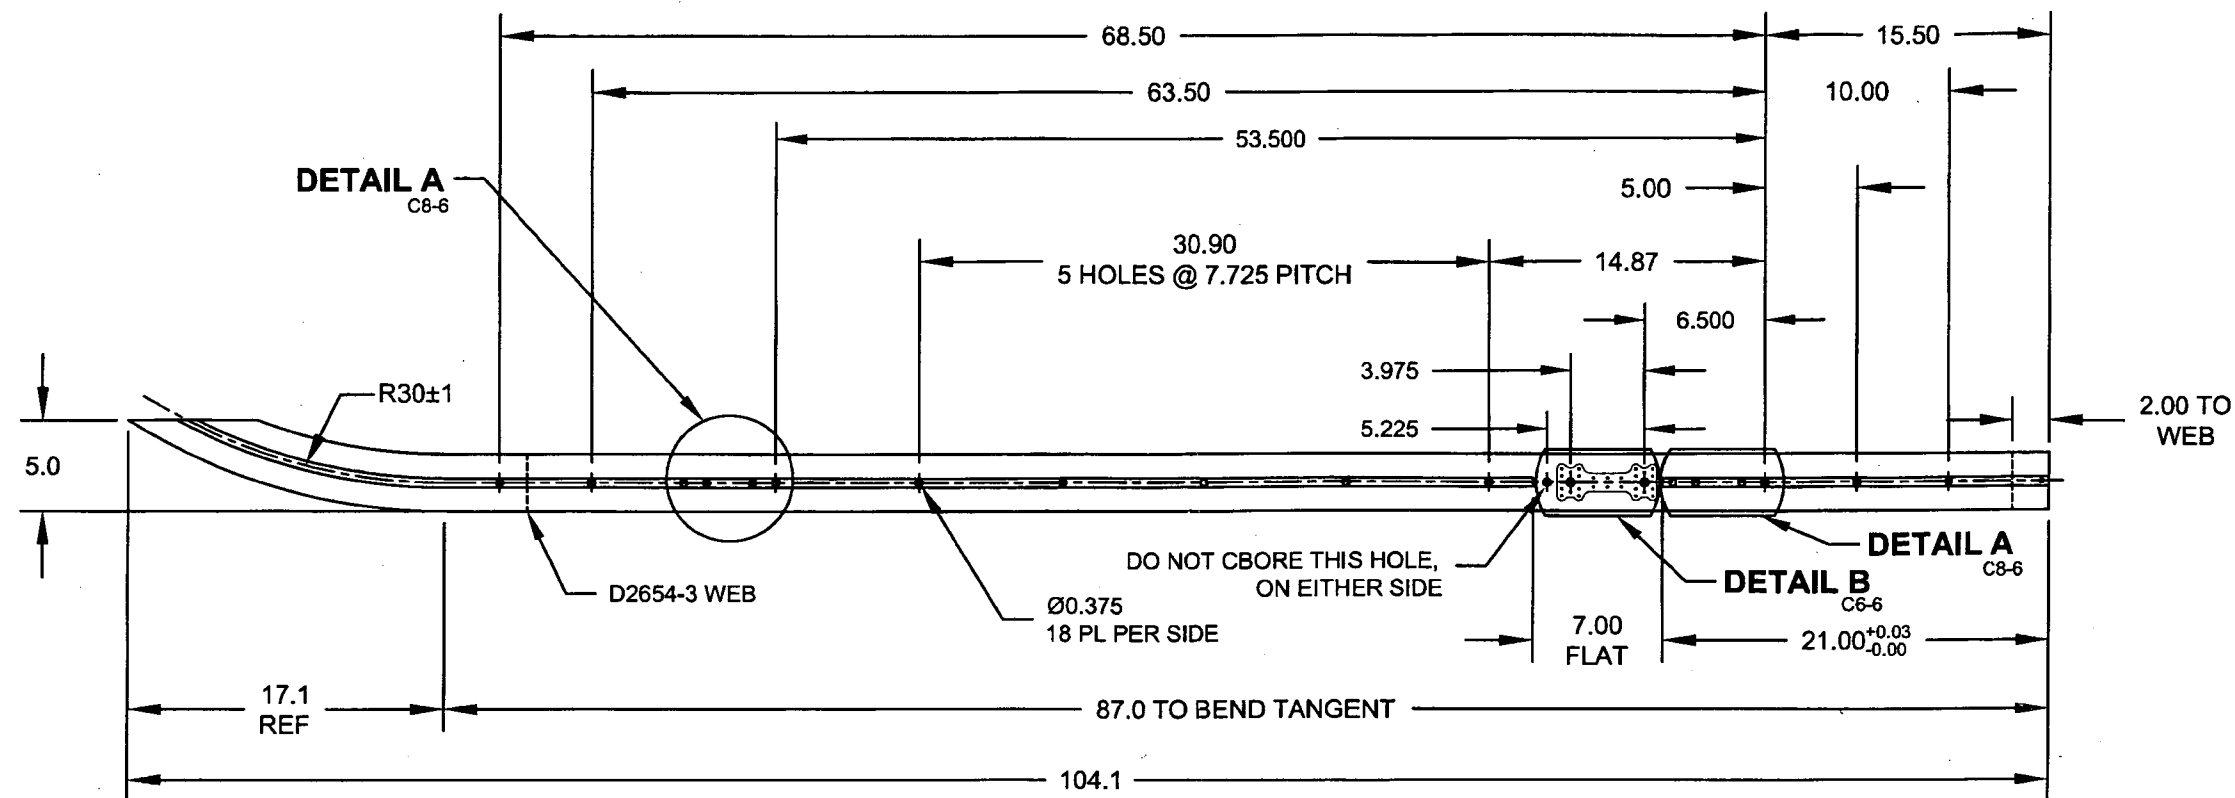


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 43767

**RELEASED**  
08-07-22-111

DESIGN	DS	<b>DART AEROSPACE USA, INC</b> PORT HADLOCK, WA	
DRAWN	AJS		
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

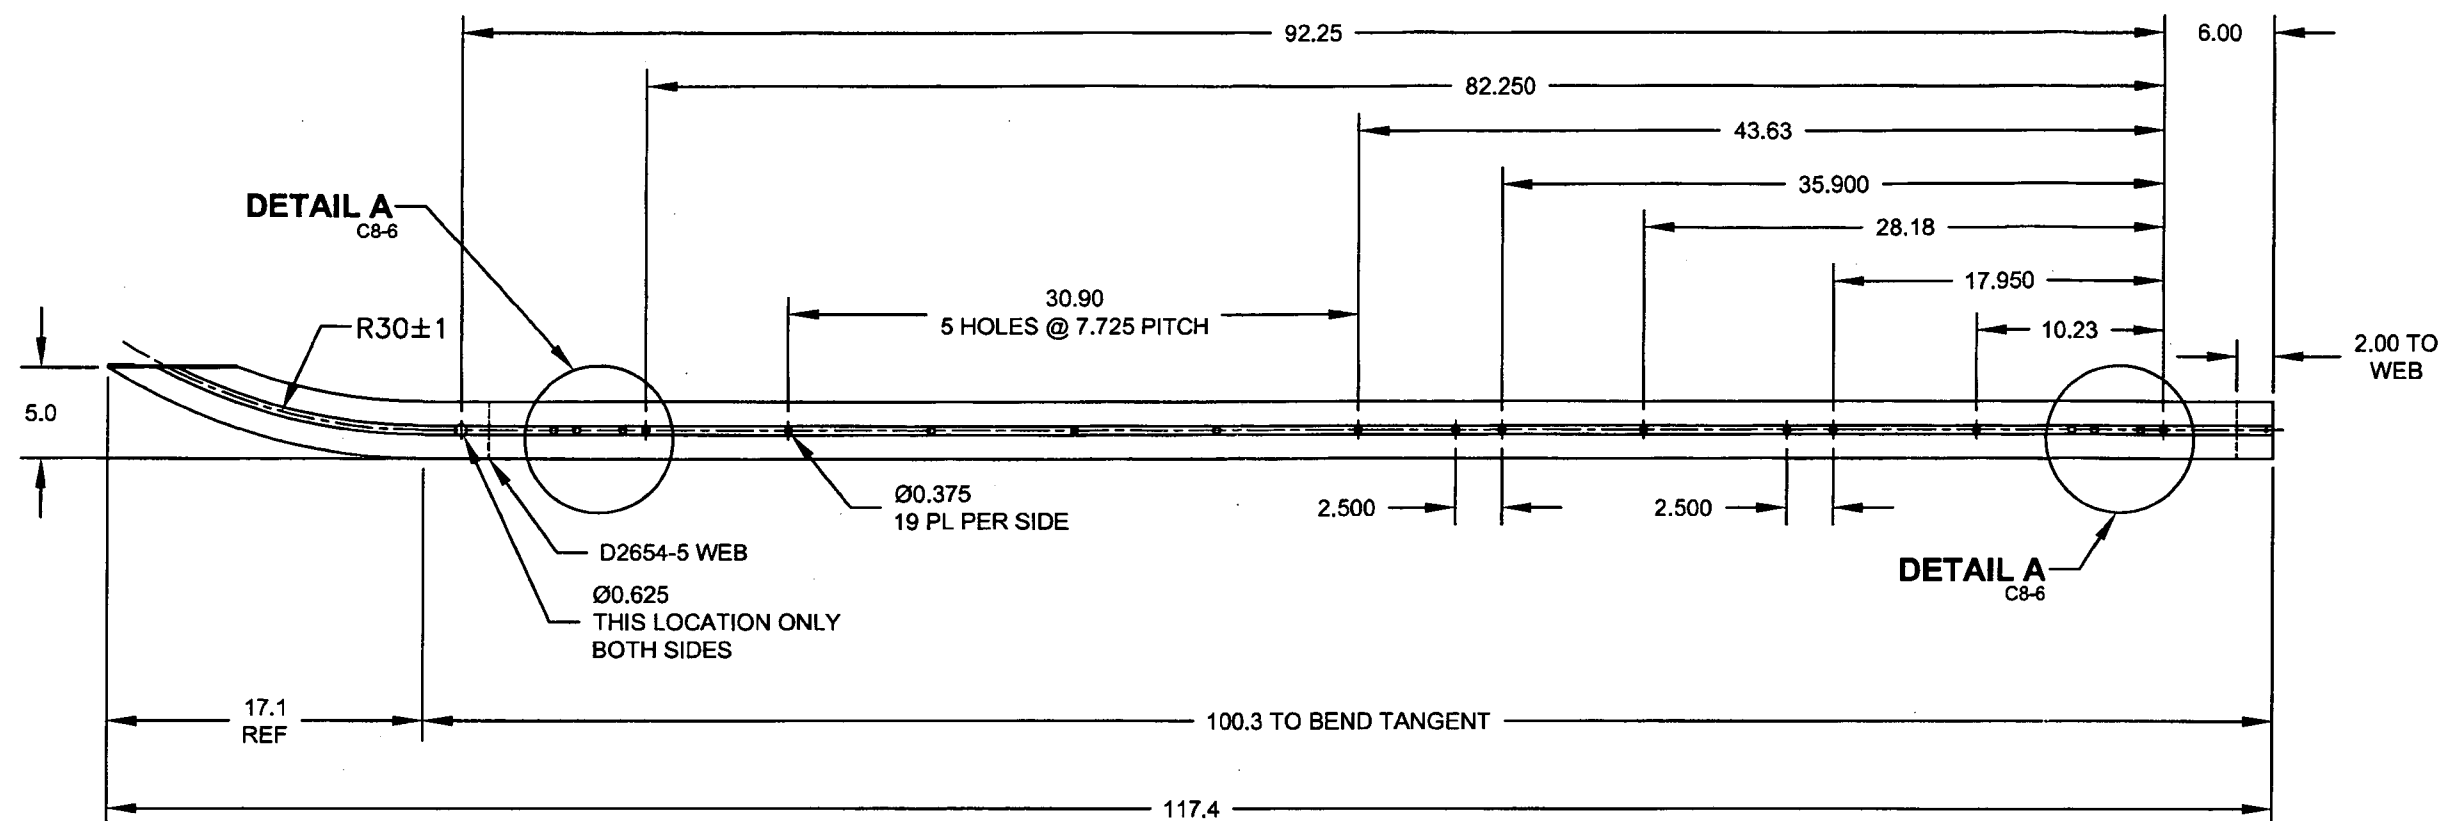

**D2650-5 BENDING/DRILLING DETAIL**

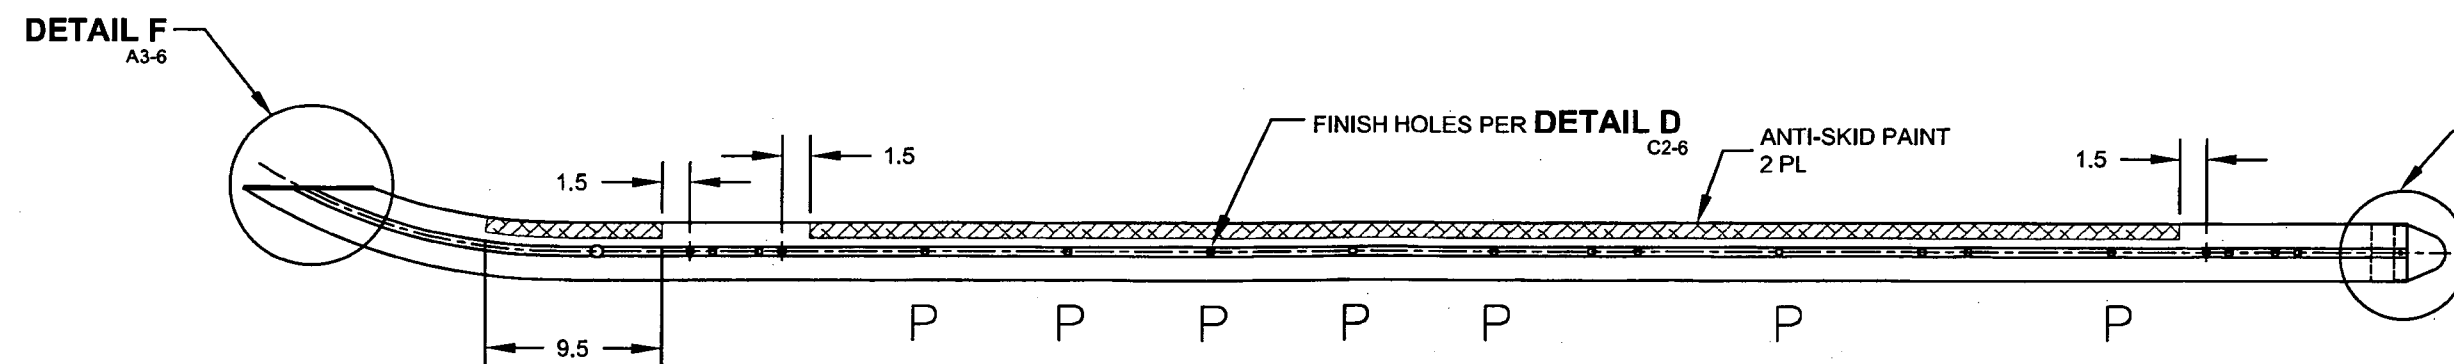

**D2650-5 ASSEMBLY/FINISHING DETAIL**


SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 43796A

**DETAIL E A7-6**

**RELEASED**  
08.09.22/117

DESIGN	DS	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED	J	DRAWING NO.	REV. F
MFG. APPR.	E	D2650	SHEET 4 OF 6
APPROVED	H	TITLE	SCALE
DE APPR.	H	206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	




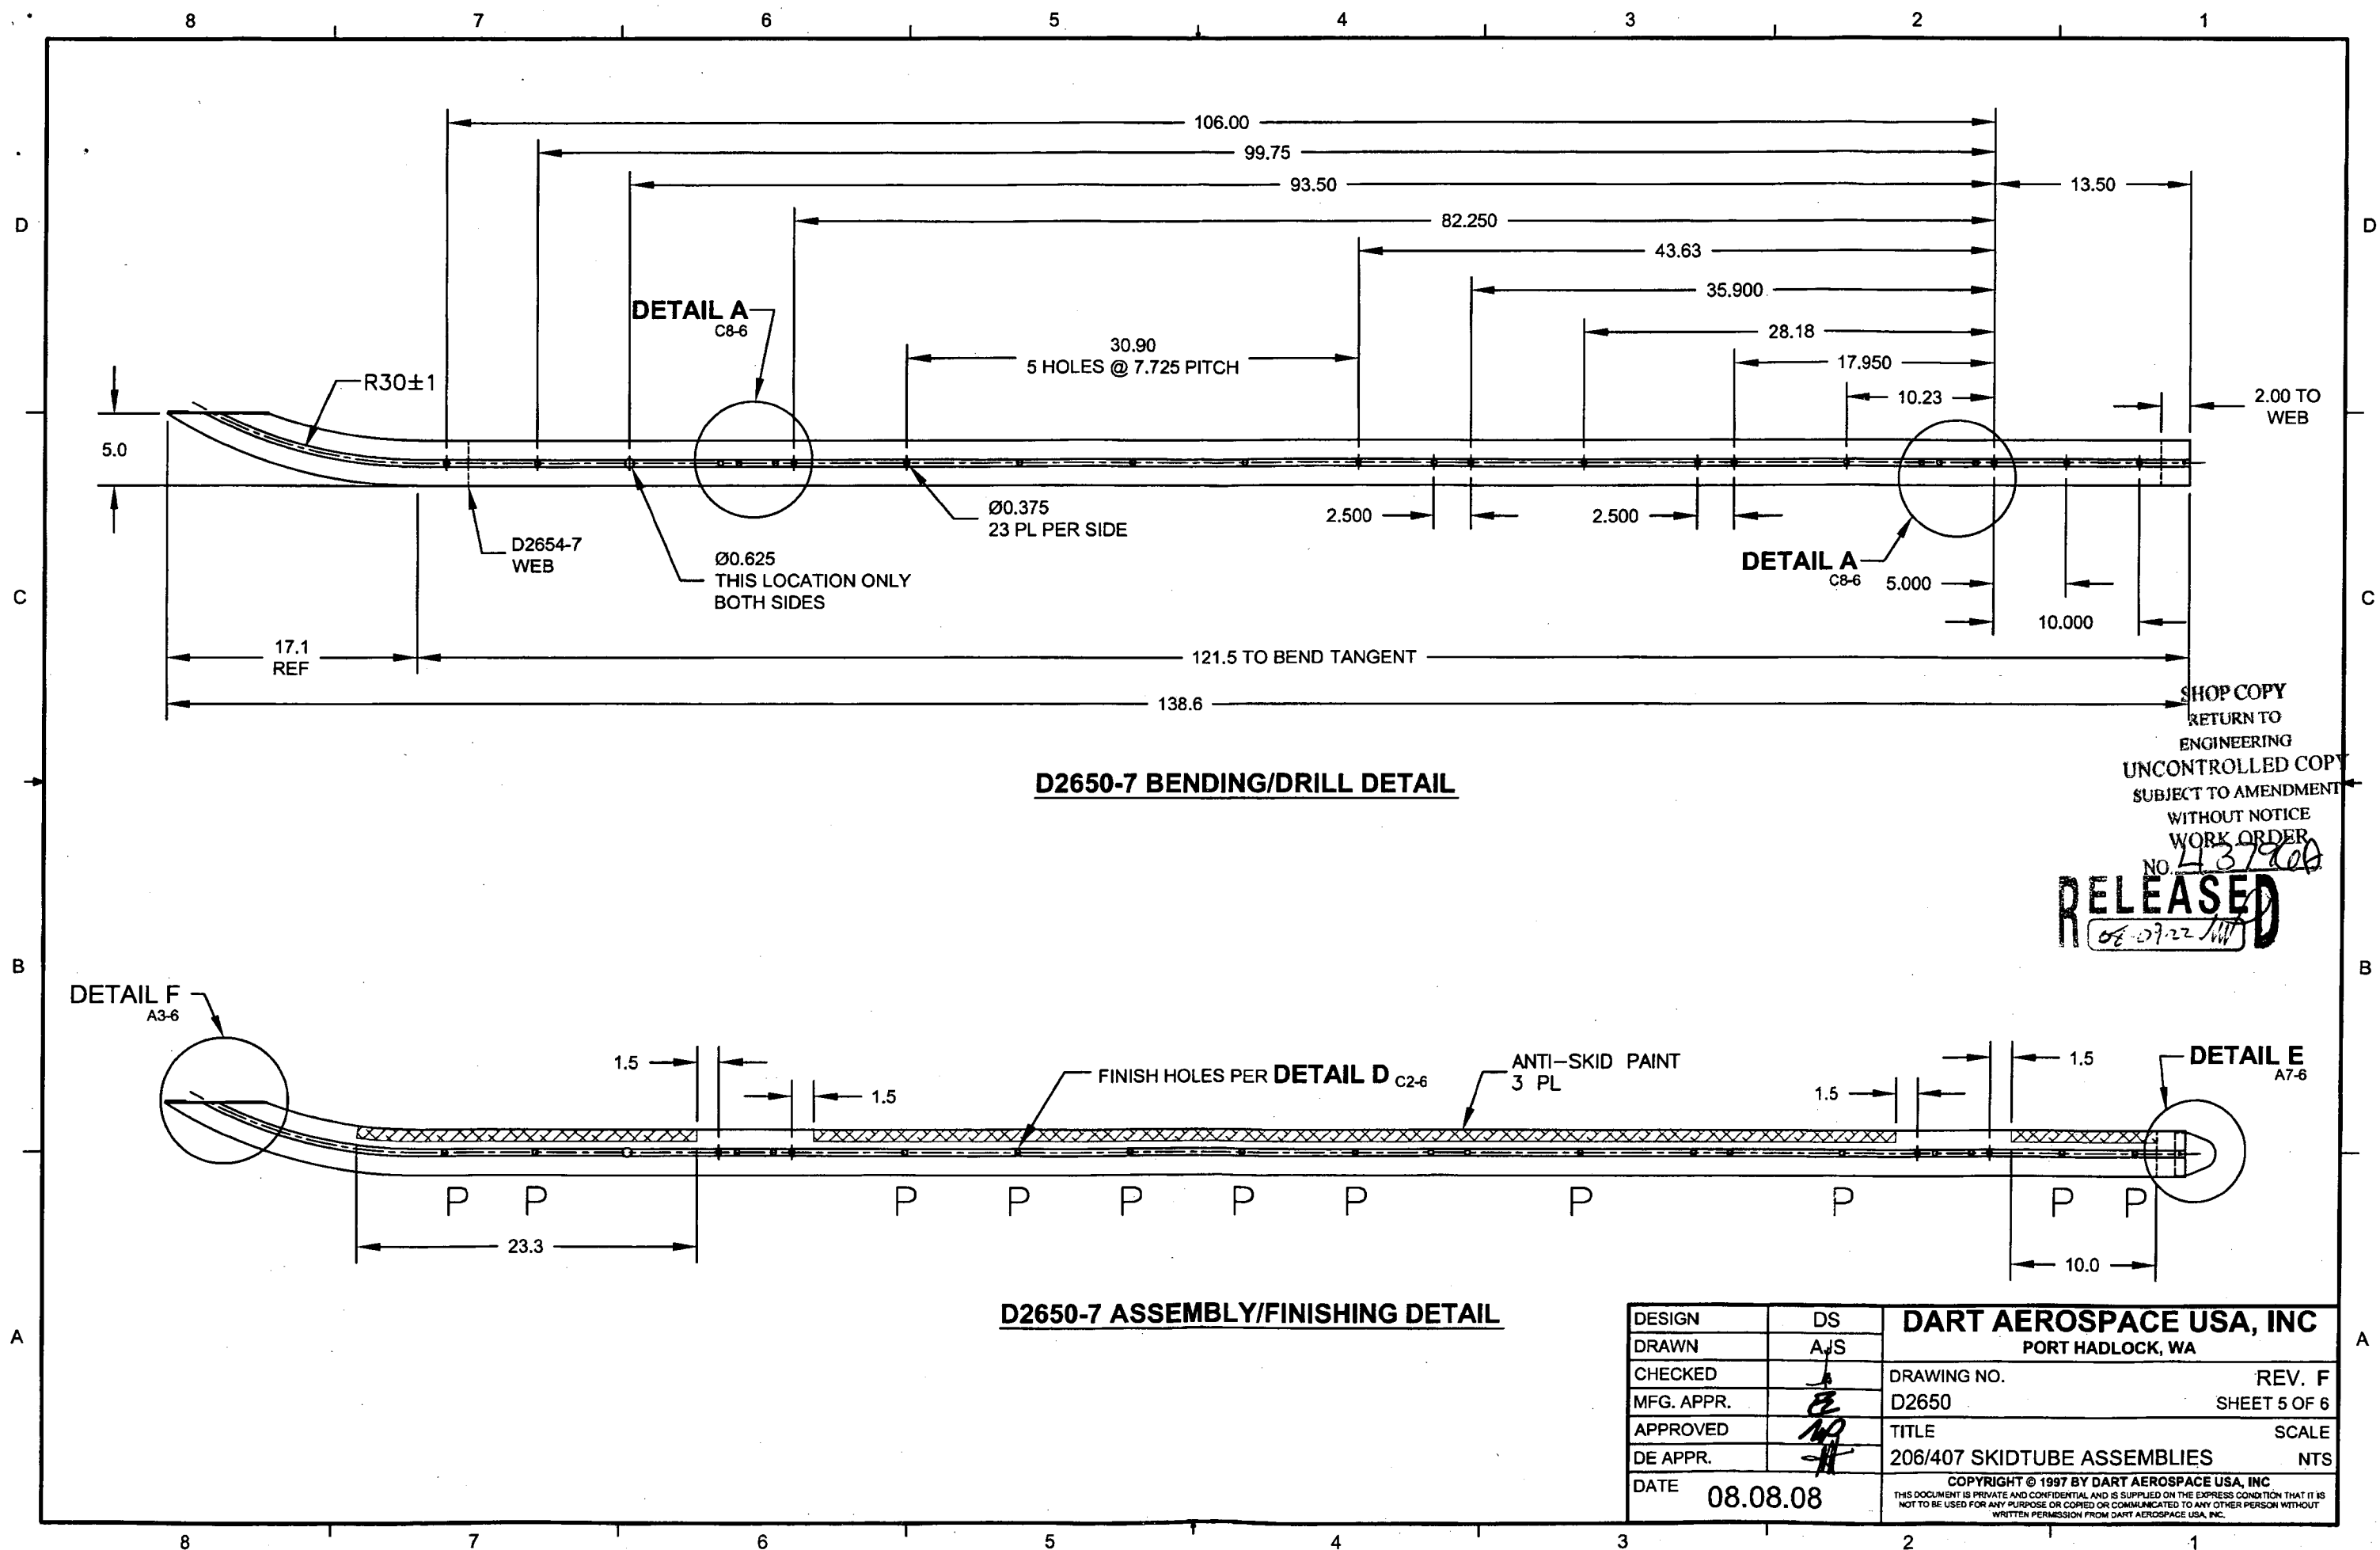

SHOP COPY  
RETURN TO  
ENGINEERING  
UNCONTROLLED COPY  
SUBJECT TO AMENDMENT  
WITHOUT NOTICE  
WORK ORDER  
NO. 437900

**RELEASED**  
08-07-22

DESIGN	DS	<b>DART AEROSPACE USA, INC</b>	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 5 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	<small>COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

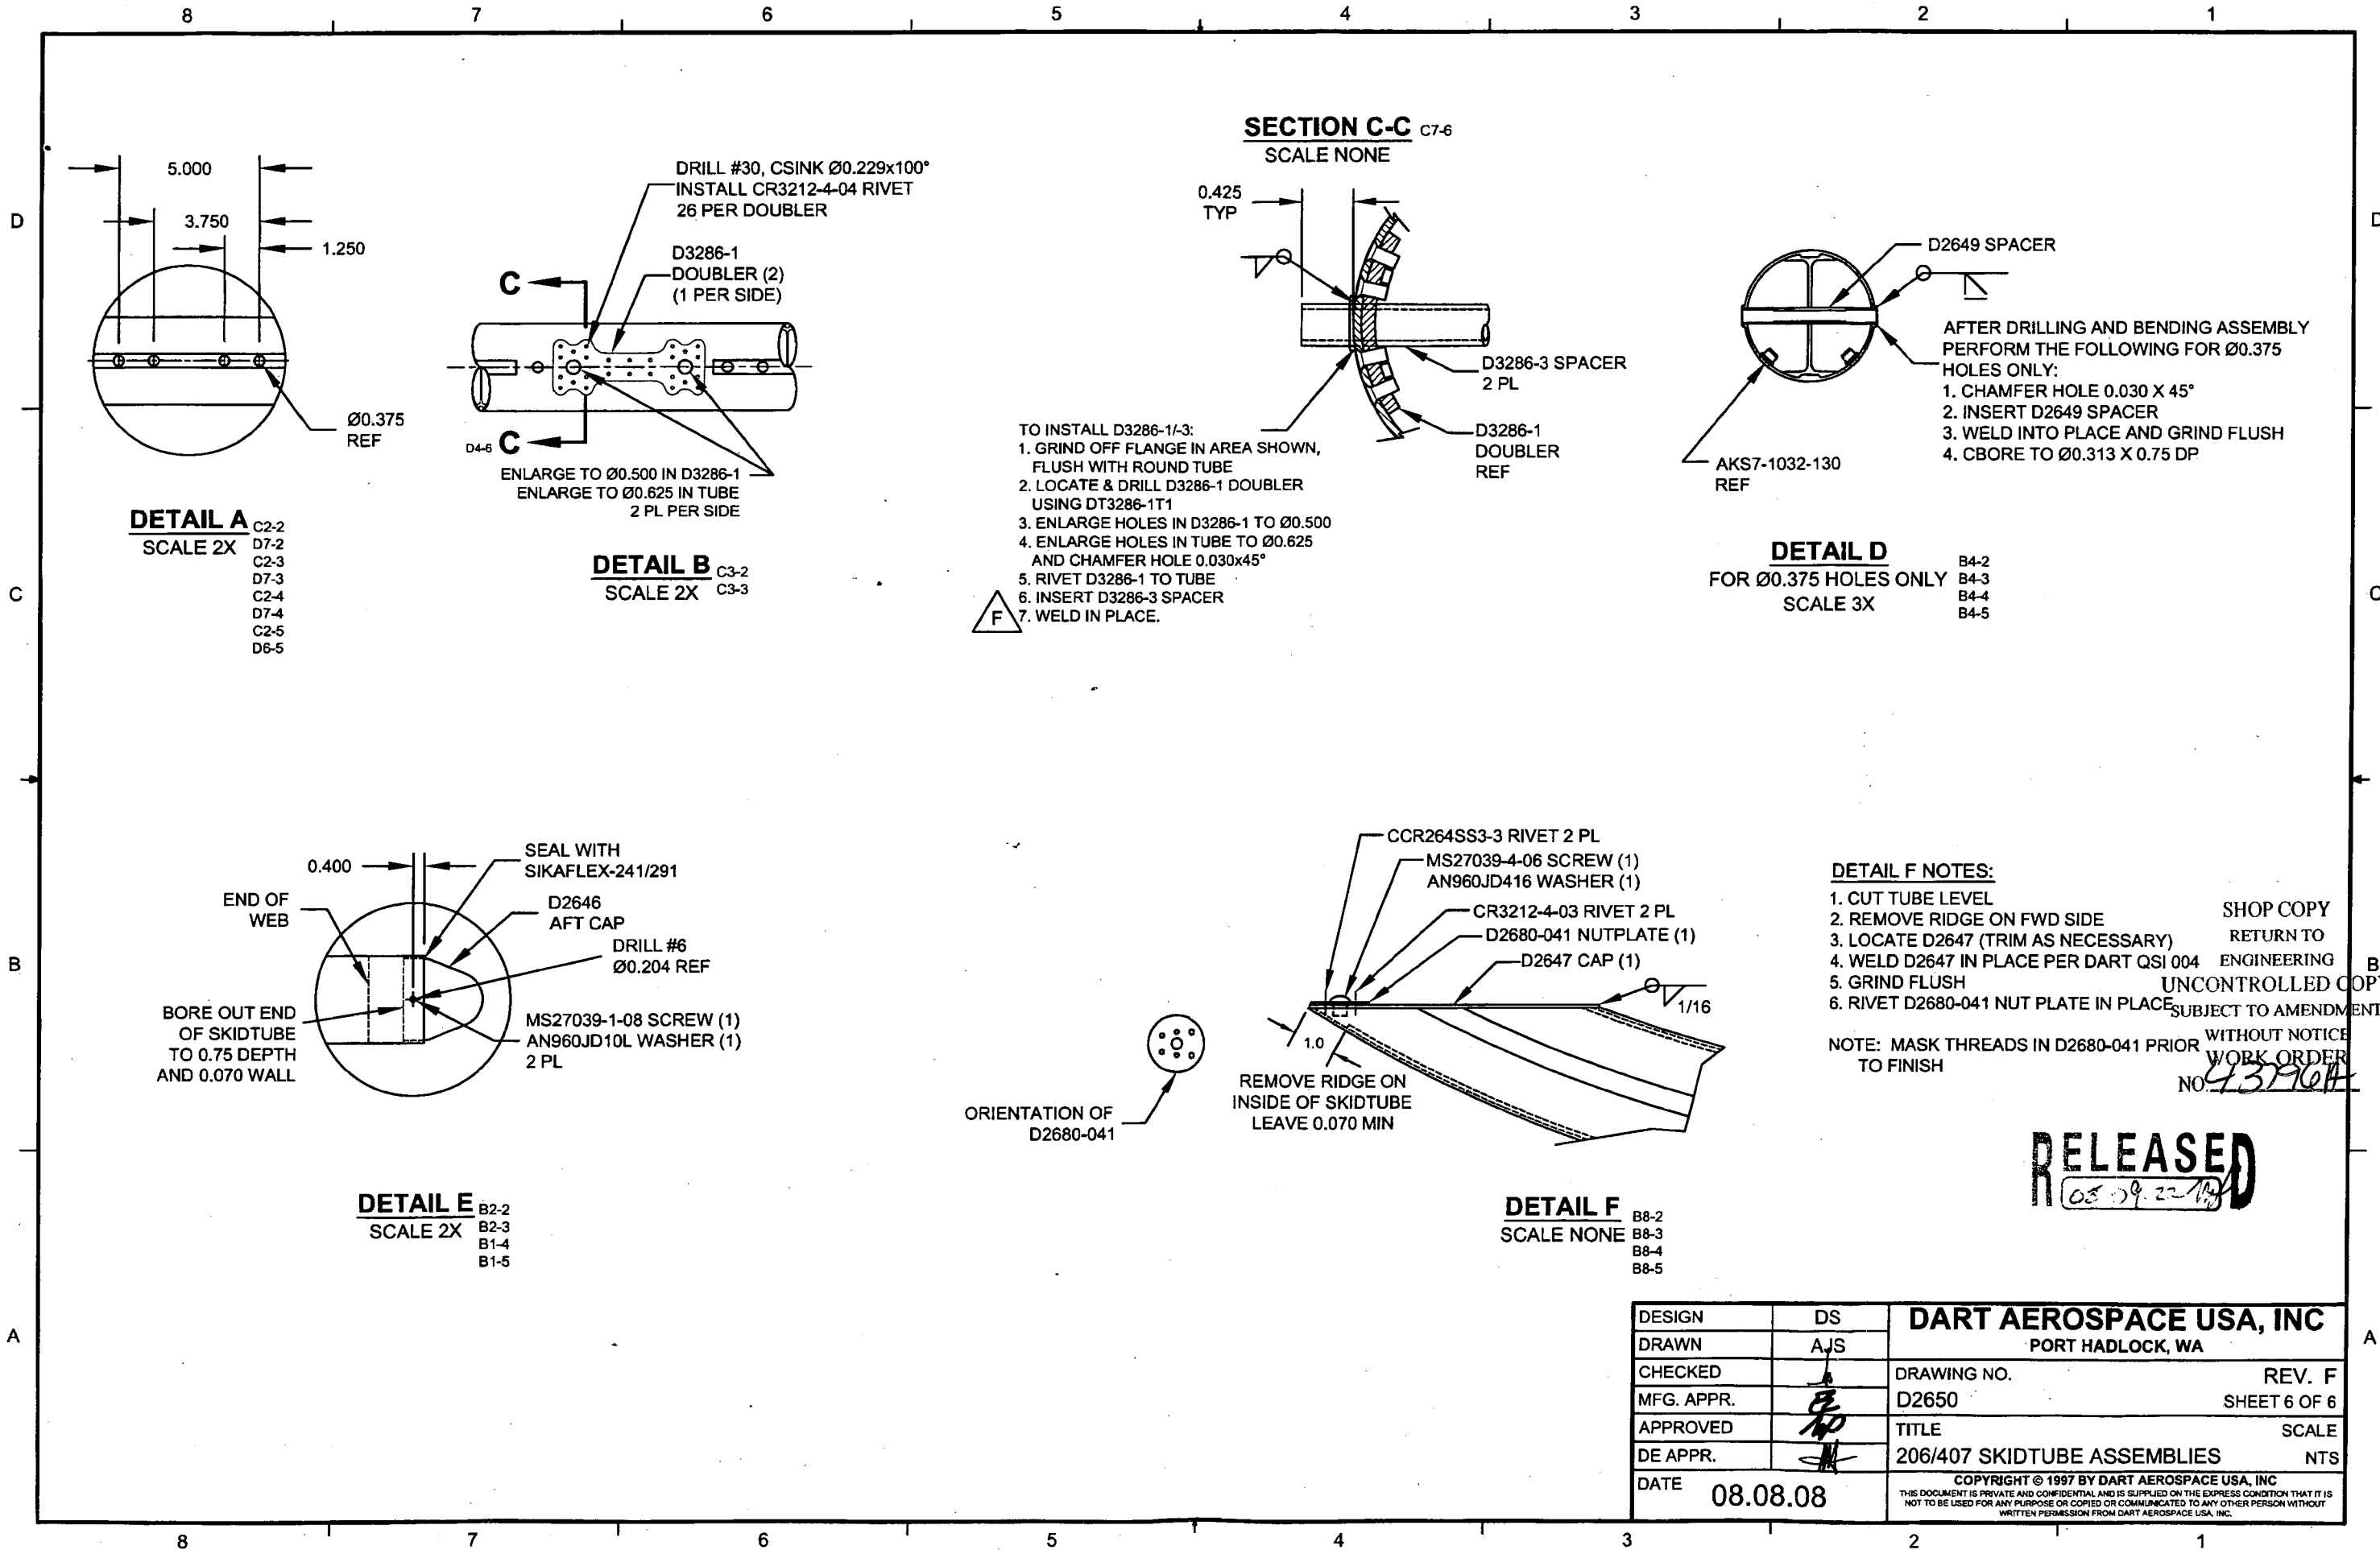



NO. 184

**AWS D17.1.2001  
QUALIFICATION TEST RECORD**

Name: Barclay Elliot  
Job number: B43107A  
Part number: 1206 642 241  
Description: 206 Skid tube  
Welding Process: Tig[☒] Mig[ ]  
Base material: Alum  
Current: AC[☒] DC[ ]

**TEST REQUIREMENTS AND RESULTS**

Visual: pass[☒] fail[ ]  
Penetration: pass[☒] fail[ ]

**UNACCEPTABLE**

Cracks: pass[☒] fail[ ]  
Undercut: pass[☒] fail[ ]  
Pin holes: pass[☒] fail[ ]  
Overlap (cold lap): pass[☒] fail[ ]  
Porosity (surface): pass[☒] fail[ ]  
Coloration: pass[☒] fail[ ]

Qualifier David Paul Date of Test Coupon 08/11/28  
Welder Barclay Elliot Date of Test Coupon 08/11/28

The above named individual is qualified in accordance with AWS D17.1.2001 to weld